

## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 1 Introduction

The TBBT01 Bias-Tee is a device for measuring the saturation effects of power inductors and bias voltage effects on capacitors. The majority of available Bias-Tees for power inductor testing operate at low frequencies, rendering them unsuitable for evaluating decoupling/bias inductors of RF power amplifiers or EMC filters. However, RF Bias-Tees usually have restricted current capabilities and cannot be employed in the lower frequency region. The TBBT01 can measure high bandwidth as well as high current.

Power inductors are subject to magnetic saturation effects since they often have ferrite cores. Even before reaching the magnetic saturation current specified in inductor data sheets, the inductance begins to decrease and the RF properties of the component degenerate.

The effect of DC current is frequently underestimated while building EMC filters, and the filter fails to work as planned. High current Bias-Tees for current injection are required to assess the frequency response of an EMC-filter under load conditions.

High current bias tees can be used for a wide range of additional applications. Wherever inductors are used for decoupling and filtering in DC paths, it is best procedure to measure inductance under load current conditions. The same holds true for bias current-carrying pulse transformers.

The TBBT01 can inject up to 10A DC current into a 50 Ohm RF-path and operates at frequencies between 5 kHz and 1.5 GHz.

The TBBT01's insertion loss is unrelated to injection current.




## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 2 Parameters

|                                |                                                                                                         |
|--------------------------------|---------------------------------------------------------------------------------------------------------|
| Usable frequency range:        | 5 kHz – 1.2 GHz                                                                                         |
| RF path insertion loss:        | <1 dB typ. in the range 10 kHz – 1 GHz<br>< 1.5 dB in the range 5 kHz – 1.2 GHz                         |
| VSWR:                          | 1 < VSWR < 2 in the range 5 kHz to 1 GHz                                                                |
| Characterized frequency range: | 1 kHz -3 GHz                                                                                            |
| RF power handling:             | 50 W from 5 kHz – 1 GHz                                                                                 |
| RF- connectors:                | N-female                                                                                                |
| Operating voltage range:       | max. $\pm 100$ V;                                                                                       |
| Operating current range:       | $\pm 5$ A to 10 A DC; see heat up characteristics plot<br>$\pm 5$ A DC continuous<br>max. $\pm 15$ A DC |
| DC path resistance:            | < 1.5 $\Omega$ @ 22°C                                                                                   |
| DC input socket:               | Phoenix Contact 1998933, male<br>mating female terminal: Phoenix Contact 1967375                        |
| Dimensions:                    | 150 mm x 155 mm x 330 mm;                                                                               |
| Weight:                        | 3 kg                                                                                                    |


### 3 Insertion loss

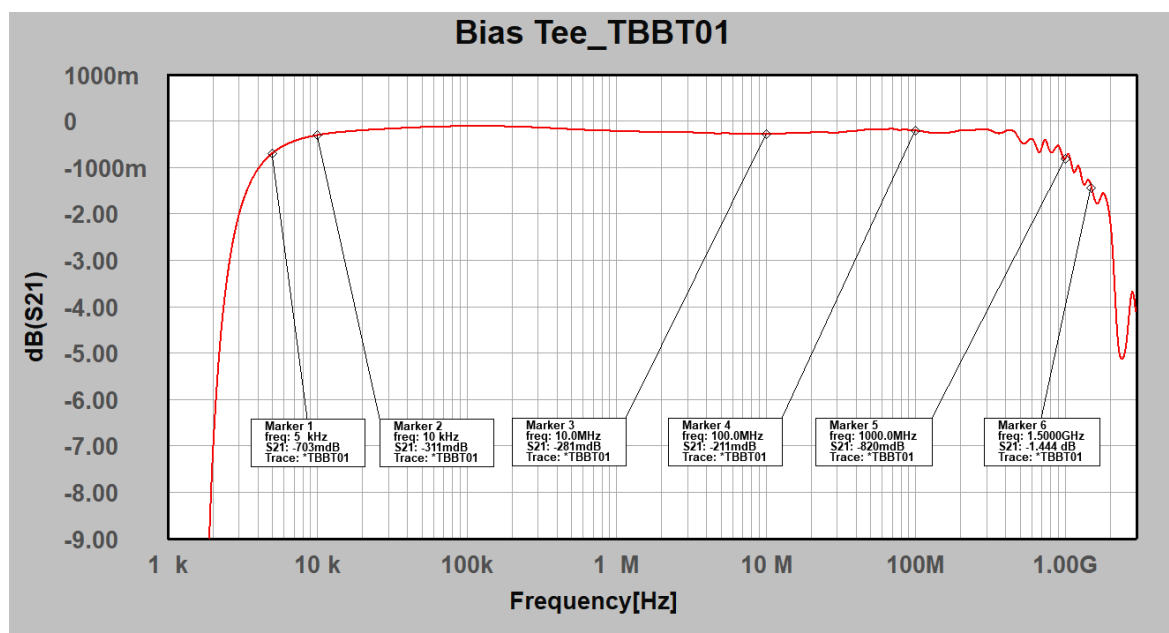

*TBBT01, Insertion Loss, 1 kHz – 3 GHz*

## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 4 Principle schematic

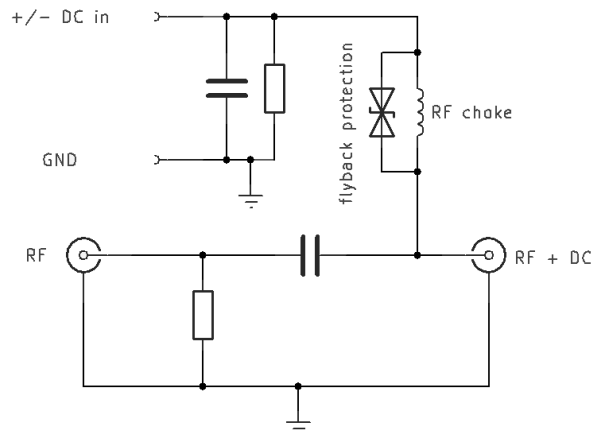

*Simplified schematic of the TBBT01*

### 5 Protection

Bias-Tees serve as a protective barrier between delicate test equipment and high voltage or high current sources. It is critical to comprehend any potential risks related to its operation.

There are three probable sources of high voltage spikes on the RF path:

- 1) The TBBT01 bias path contains high inductance chokes, which could create flyback voltage spikes. As a result, the Bias Tee is designed with transient suppressors fitted across the choke terminals.
- 2) When operating the device at high voltages, the coupling capacitor potentially could inject high voltage into the RF-path. This could be avoided by connecting a transient suppressor between RF path and ground. However, suppressors with a short turn on time and low capacitance are susceptible to high energy pulses and tend to short out, necessitating Bias-Tee repair. Furthermore, the Bias-Tee could not handle high RF power with such suppressors in place. As a result, the RF path of the TBBT01 is not equipped with any transient suppressors. Thus, avoid rapidly switching high external supply voltages on and off.


**Always increase or decrease the bias voltage or current gradually. Don't turn it rapidly on/off.**

Alternatively, use limiters or attenuators to protect the RF ports of the attached test equipment. One more option is to install transient suppressors on the external component test PCB.

- 3) When measuring high inductance power inductors, rapid changes in bias current can create flyback transients directly on the RF path. As the RF ports are not protected from potential flyback pulses of the inductor under test, Tekbox supplies test PCBs equipped with RF transzorbers. If you make your own test PCBs, add appropriate transzorbers or ramp the current up/down gently instead of turning it on/off quickly.

## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A


### 6 Thermal characteristics

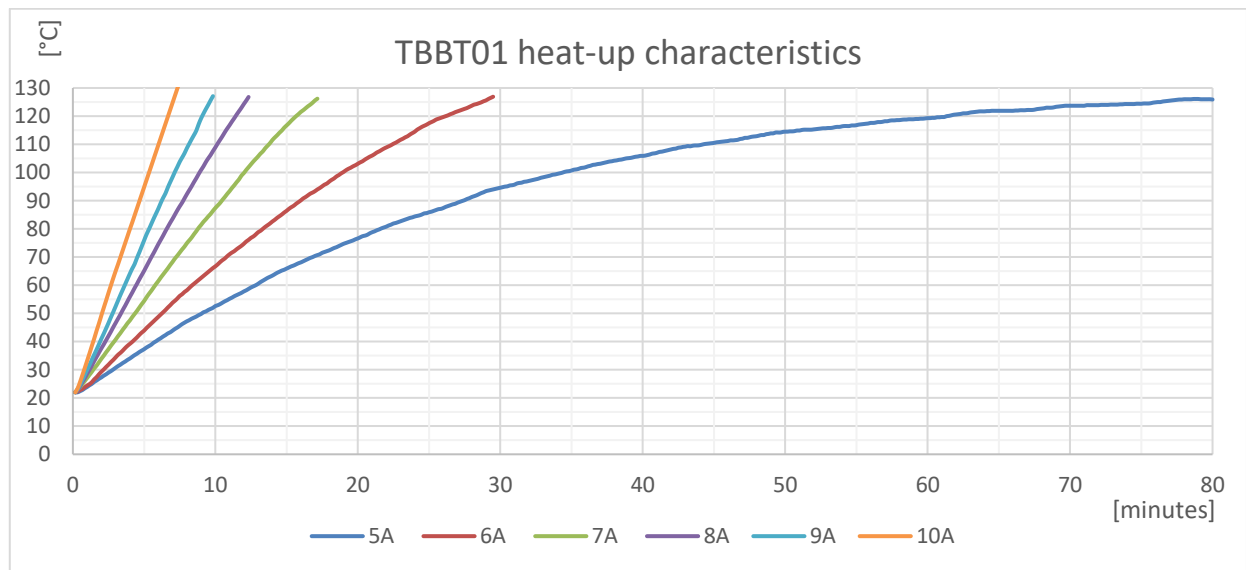

*Coil temperature vs. current*

Limit the measurement time to keep the coil temperature below 125°C

### 7 VSWR

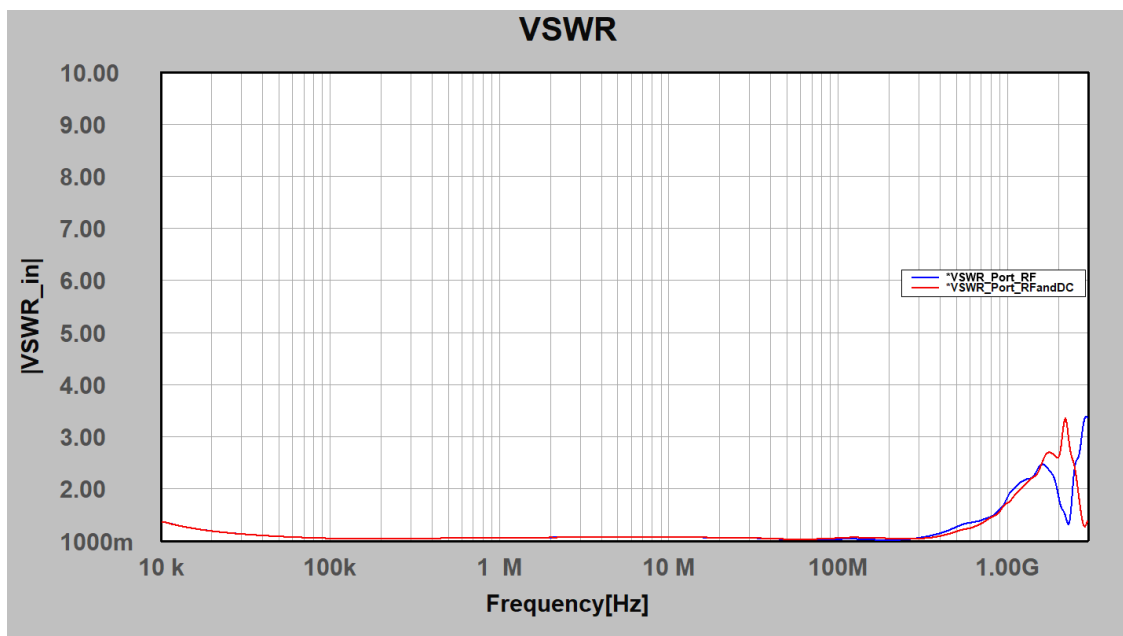


*VSWR; Port RF, PORT RF+DC*

## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 8 Application examples


#### 8.1 Inductor impedance vs. frequency and current

- 1) Connect a Vector Network Analyzer to the RF-port of the Bias-Tee. Carry out an OSL calibration at the RF+DC - port of the Bias-Tee.

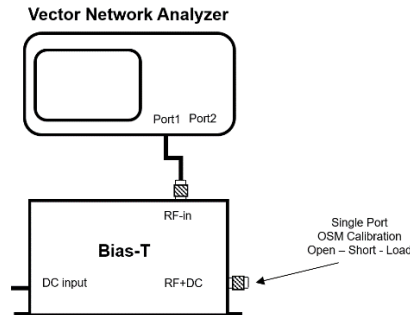


Calibration setup

- 2) Connect a test PCB with the inductor to the RF+DC port. Depending on coaxial couplers and the length of the PCB, you may enter a suitable electrical delay to shift the “Open” to the end of the transmission line on the test PCB. Solder the inductor to the test PCB and carry out impedance measurements for various bias currents.

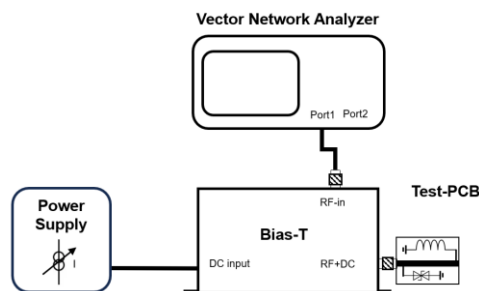

Measurement setup

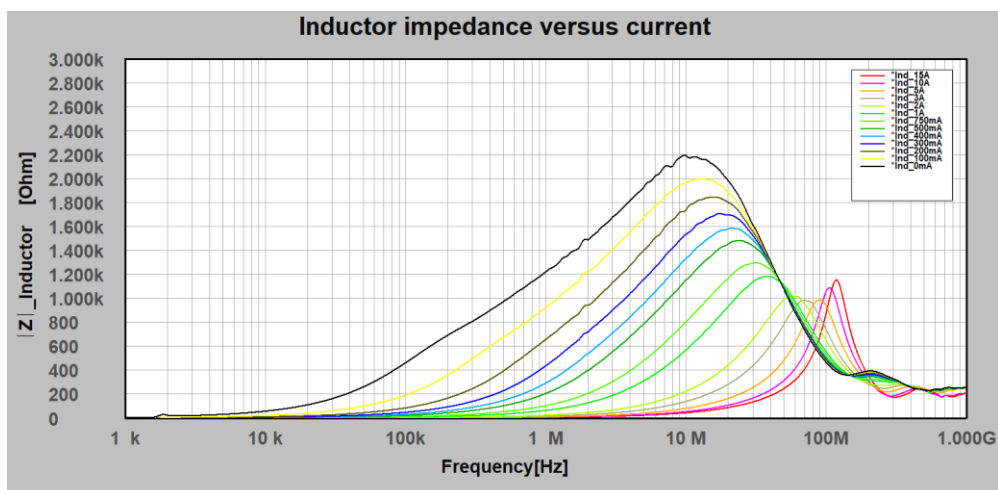


Impedance of an inductor vs. current; 10 turns on a FT-100A-75 torroid core; 0 – 15 A


## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 8.2 EMC-filter characteristics versus load current


- 1) Connect two Bias-Tees using coaxial adapters as depicted below and make a through calibration

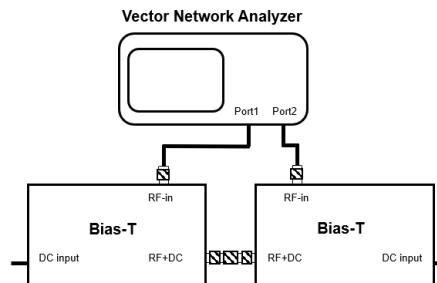

- 2) Connect the test PCB with the EMC-filter in between two Bias-Tees and measure S21 for various bias currents

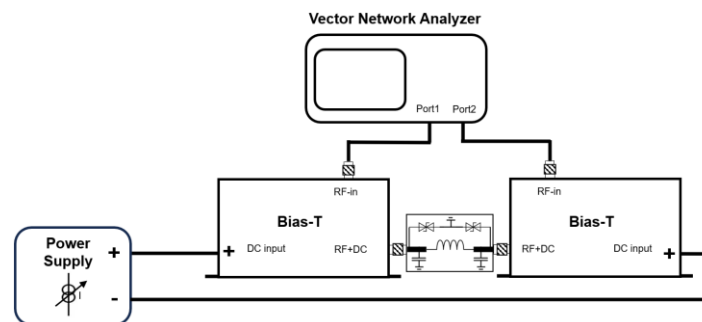

Note that the EMC – Filter is measured in a 50 Ohm system. In real applications, the filter is terminated with the source and load impedance.

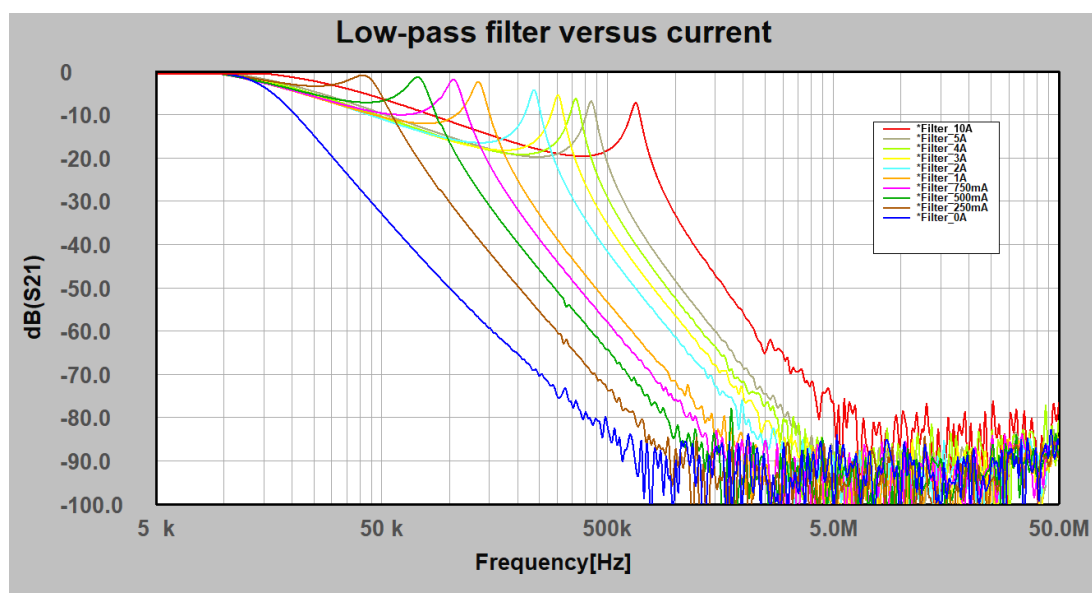


EMC low-pass filter characteristics; 0 – 10A load current



## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 8.3 RF choke versus supply current

- 1) To investigate suitability of an RF choke for a RF power amplifier output transistor, make a through calibration of a setup as depicted below.

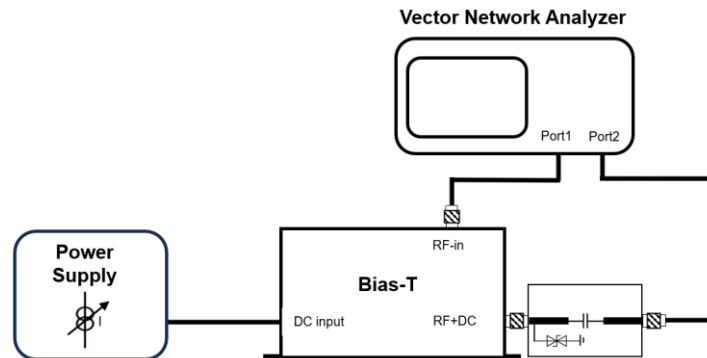

- 2) Next add the RF choke and measure its effect on the S21 of the output path.

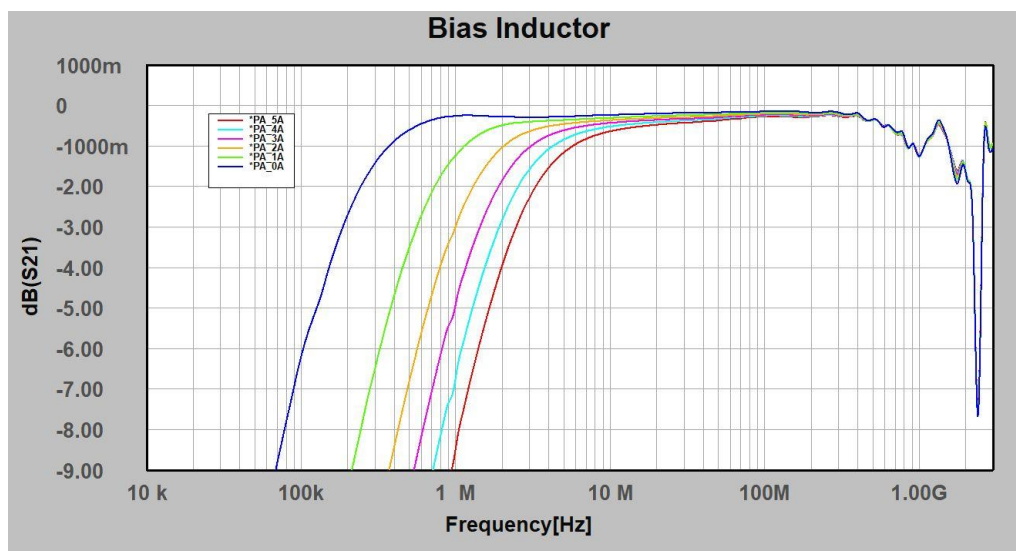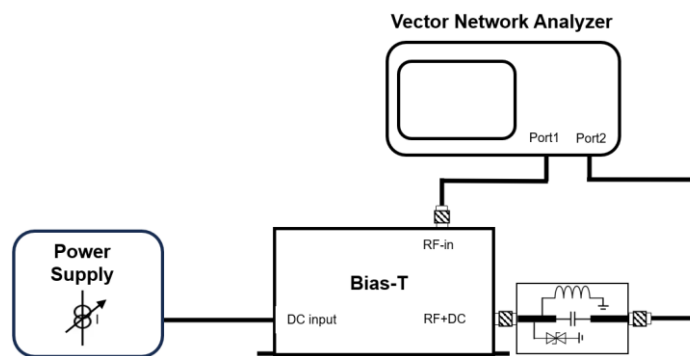


*Insertion loss caused by an RF choke; 5 turns on a 43 material core 5943007601; 0 to 5A*



## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 8.4 Capacitor versus bias voltage

- 1) To investigate capacitance versus bias voltage, prepare a test PCB as depicted below and perform a single channel S11 OSL calibration at low frequency, e.g. from 10kHz – 15kHz. As decoupling capacitor, use a large, high voltage foil capacitor; e.g.  $\geq 10\mu\text{F} / 200\text{V}$

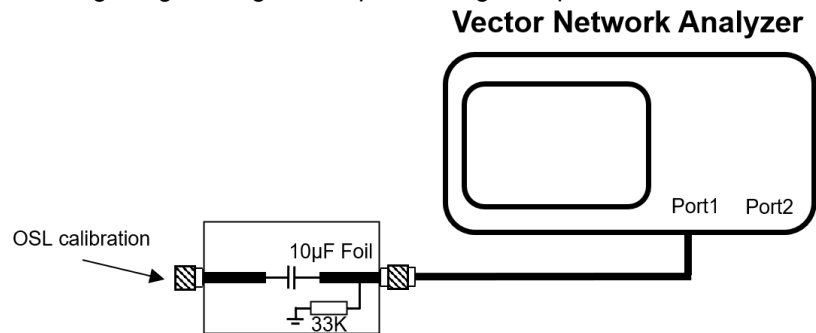

- 2) Solder the capacitor under test to the test-PCB as depicted below and measure the capacitance (imaginary part of S11) for various bias voltages

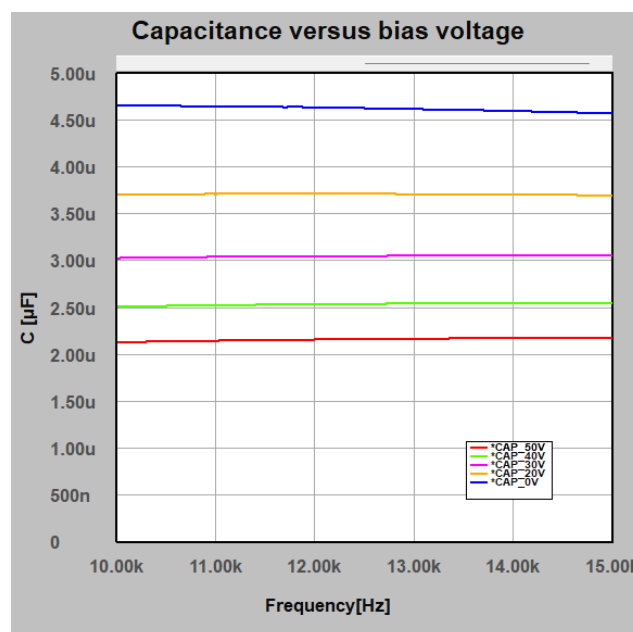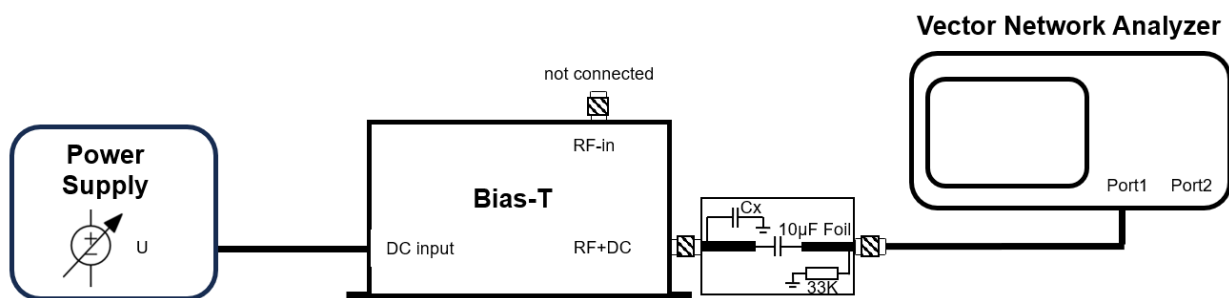

Capacitance variation versus bias voltage;  $4.7\mu\text{F}/50\text{V}$ , X7R, 1206; CL31B475KBHVPNE

## Bias-Tee, 5 kHz – 1.2 GHz, 5 - 10A

### 9 Optional Accessories - Test PCBs

#### TBBT01-TPCB1

Test PCB for inductor saturation measurement; unpopulated, but equipped with N-connector

#### TBBT01-TPCB2

Test PCB for EMC filter measurement; unpopulated, but equipped with N-connectors

#### TBBT01-TPCB3

Test PCB for RF choke measurement; unpopulated, but equipped with N-connectors

#### TBBT01-TPCB4

Test PCB for capacitor measurement; unpopulated, but equipped with N-connectors

### 10 Ordering Information

| Part Number | Description                                                   |
|-------------|---------------------------------------------------------------|
| TBBT01      | Bias-Tee, 1pc. female terminal blocks Phoenix Contact 1967375 |

#### Optional Accessories:

| Part Number        | Description                                  |
|--------------------|----------------------------------------------|
| TBBT01-TPCB1       | Test PCB for inductor saturation measurement |
| TBBT01-TPCB2       | Test PCB for EMC filter measurement          |
| TBBT01-TPCB3       | Test PCB for RF choke measurement            |
| TBBT01-TPCB4       | Test PCB for capacitor measurement           |
| TBBT01-Through_N/M | Coaxial through adapter, N-male              |
| TBBT01-Through_N/F | Coaxial through adapter, N-female            |

### 11 History

| Version | Date       | Author     | Changes                                                        |
|---------|------------|------------|----------------------------------------------------------------|
| V1.0    | 14.7.2023  | Mayerhofer | Creation of the document                                       |
| V1.1    | 17.1.2024  | Mayerhofer | Correction of Phoenix part number in chapter 10                |
| V1.2    | 18.12.2024 | Mayerhofer | Correction of the quantity of Phoenix connectors in chapter 10 |
| V1.3    | 23.02.2026 | Mayerhofer | Replaced photos                                                |